Deleted: 07

Project	IEEE 802.16 Broadband Wireless Access Working Group <a href="http://ieee802.org/16">http://ieee802.org/16</a> >							
Title	UL HARQ with Relays							
Date Submitted	2007-1- <u>15</u>	/						
Source(s)	Haihong Zheng, Yousuf Saifullah, Shashikant Maheshwari Nokia 6000 Connection Drive, Irving, TX	Voice: 972 894 5000 Fax: haihong.1.zheng@nokia.com, shashikant.maheshwari@nokia.com, Yousuf.saifullah@nokia.com						
	Junichi Suga Fujitsu Laboratories Ltd. Kamikodanaka 4-1-1, Kawasaki, 211-8588, Japan	Voice: +81-44-754-2811 Fax: +81-44-754-2786 Email: suga.junichi@jp.fujitsu.com						
	Michiharu Nakamura Fujitsu Laboratories LTD 5-5, Hikarinooka Yokosuka, Japan. 239-0847	Voice: +81-46-839-5371 Fax: +81-46-839-5560 Email: michi@labs.fujitsu.com						
	Aik Chindapol, Jimmy Chui, Hui Zeng Siemens Corporate Research 755 College Road East, Princeton, NJ, USA	Voice: +1 609 734 3364 Fax: +1 609 734 6565 Email: aik.chindapol@siemens.com						
	Byung-Jae Kwak, Suchang Chae, Young-il Kim ETRI 161, Gajeong-Dong, Yuseong-Gu, Daejeon, Korea 305-350	Voice: +82-42-860-6618 Fax: +82-42-861-1966 bjkwak@etri.re.kr						
	Kyu Ha Lee Samsung Thales San 14, Nongseo-Dong, Giheung-Gu, Yongin, Gyeonggi-Do, Korea 449-712	Voice: +82-31-280-9917 Fax: +82-31-280-1562 Email: kyuha.lee@samsung.com						
Re:	This is in response to the call for propos	als 80216j-06_034.pdf						
Abstract	This contribution proposes a procedure	for handling retransmission of HARQ failure attempts in a						

	relay system.
Purpose	Add proposed spec changes in P802.16j Baseline Document (IEEE 802.16j-06/026r1)
Notice	This document has been prepared to assist IEEE 802.16. It is offered as a basis for discussion and is not binding on the contributing individual(s) or organization(s). The material in this document is subject to change in form and content after further study. The contributor(s) reserve(s) the right to add, amend or withdraw material contained herein.
Release	The contributor grants a free, irrevocable license to the IEEE to incorporate material contained in this contribution, and any modifications thereof, in the creation of an IEEE Standards publication; to copyright in the IEEE's name any IEEE Standards publication even though it may include portions of this contribution; and at the IEEE's sole discretion to permit others to reproduce in whole or in part the resulting IEEE Standards publication. The contributor also acknowledges and accepts that this contribution may be made public by IEEE 802.16.
Patent Policy and Procedures	The contributor is familiar with the IEEE 802.16 Patent Policy and Procedures <a href="http://ieee802.org/16/ipr/patents/policy.html">http://ieee802.org/16/ipr/patents/policy.html</a> , including the statement "IEEE standards may include the known use of patent(s), including patent applications, provided the IEEE receives assurance from the patent holder or applicant with respect to patents essential for compliance with both mandatory and optional portions of the standard." Early disclosure to the Working Group of patent information that might be relevant to the standard is essential to reduce the possibility for delays in the development process and increase the likelihood that the draft publication will be approved for publication. Please notify the Chair <a href="mailto:chair@wirelessman.org">mailto:chair@wirelessman.org</a> as early as possible, in written or electronic form, if patented technology (or technology under patent application) might be incorporated into a draft standard being developed within the IEEE 802.16 Working Group. The Chair will disclose this notification via the IEEE 802.16 web site <a href="http://ieee802.org/16/ipr/patents/notices">http://ieee802.org/16/ipr/patents/notices</a> >.

# **UL HARQ with Relays**

Haihong Zheng, Yousuf Saifullah, and Shashikant Maheshwari - Nokia Junichi Suga, and Michiharu Nakamura - Fujitsu Aik Chindapol, and Jimmy Chui – Siemens Byung-Jae Kwak, Suchang Chae, Young-il Kim - ETRI Kyu Ha Lee - Samsung Thales

# **Problem Description**

In single hop system, HARQ is performed directly between BS and MS. However, in the relay system, there could be one or more RSs between an <u>MR-BS</u> and an MS. HARQ could be performed in the fashion of hop-by-hop (i.e., between every two adjacent stations - MS-RS2, RS2-RS1 and RS1-MR-BS as shown in Figure 1).

Deleted: MMR-BS

Deleted: MMR-BS




Figure 1: Illustration of Multi Hops in relay System

Both centralized and distributed MAP allocation mechanisms could be adopted in relay system. In centralized MAP allocation, the <u>MR-BS</u> allocates MAP for all the links. Any need for bandwidth request should go to the <u>MR-BS</u>. In distributed MAP allocation, each station allocates MAP for the adjacent link. In centralized allocation, if a HARQ packet transmission failure occurs on a non-adjacent link from <u>MR-BS</u>, then a mechanism is needed for indicating this failure to the <u>MR-BS</u>. So <u>MR-BS</u> can grant bandwidth for retransmission on the effected links.

Deleted: MMR-BS

Deleted: MMR-BS

Deleted: MMR-BS

Deleted: MMR-BS

Deleted: MMR-BS

# **UL HARQ scheme with centralized scheduling**

This contribution suggests a mechanism for indicating the last RS on the relay path that has successfully received the HARQ packet to MR-BS. The indication is only sent when the last RS receives NAK from the next station in the relay path. It is not sent when a HARQ packet is successfully transmitted on all the hops. The MR-BS uses this indication and allocates MAP accordingly so the retransmission could start from the last RS and onward.

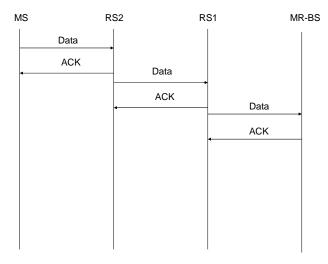


Figure 2. Message Flow for 3-hop UL HARQ

In Figure 2, the data is transmitted from the MS to RS 2 and is forwarded to RS 1 and finally to the MR-BS. As a response to a successful reception of the data, ACK is generated per hop by each receiving station and the data is removed from the buffer of the transmitting station.

This contribution is suggesting a mechanism that will work on any centralized MAP allocation scheme. It does not suggest a centralized MAP allocation scheme. It utilizes a bandwidth request mechanism proposed in [1].

This contribution describes the HARQ procedure for UL only. For the DL HARQ procedure, please consult [2].

# **Specification changes**

Insert new sub-clause 6.3.17.5

## 6.3.17.5 Relay support for HARQ in centralized scheduling

MR-BS schedules a HARQ packet on all the links between MR-BS and MS. DL transmission failure on a relay link is indicated by the orthogonal code on the UL ACK Channel while UL transmission failure on a relay link is indicated to MR-BS in a HARQ RS report, so the MR-BS can schedule the retransmission only for the links that didn't transmit packet in the last attempt. The mechanism is different for UL and DL, and it is described below. It is also described for the following cases:

Deleted: MMR-BS

Deleted: MMR-BS
Deleted: MMR-BS
Deleted: MMR-BS

- UL HARQ for non-Transparent RS
- UL HARO for Two Hop Transparent RS

Insert new sub-clause 6.3.17.5.3

#### 6.3.17.5.3 UL HARQ for non-Transparent RS

When MR-BS schedules a HARQ attempt, it allocates bandwidth over all the links from the MS to the MR-BS. Each RS on the relay path receives the uplink HARQ packet, and decodes it. If the decoding succeeds, it sends an ACK to the previous RS/MS and forwards the HARQ packet to the next hop. The previous RS/MS clears the HARQ packet from its buffer after receiving the ACK. If the decoding fails, the RS sends a NAK back to the previous station. If the previous station is a RS, then it is the last RS that has received the HARQ packet successfully. The last RS sends HARQ RS Report Extended subheader to the MR-BS indicating the HARQ packet and itself. The MR-BS sends UL-MAP accordingly, allowing retransmission from the last RS onwards, thus, retransmitting only on the links that didn't relay the HARQ packet.

Deleted: MMR-BS

Deleted: MMR-BS

Deleted: MMR-BS

**Deleted:** The subheader is sent in the same allocation allocated for the HARQ packet.

Deleted: MMR-BS

The MS behavior is unchanged with the introduction of RS. The MS does not send HARQ RS Report Extended subheader.

The ACK/NAK is sent by HARQ ACK Bitmap IE. Each RS generates HARQ ACK bitmap IE for its received HARQ packets. The UL burst positions could be altered by RS on a hop, but each receiving RS/MR-BS keeps its mapping, and generates its HARQ ACK bitmap accordingly. The receiver of the bitmap clears the buffer corresponding to the ACK bits in the bitmap, and saves the buffer corresponding to the NAK bits.

Deleted: MMR-BS

6.3.17.5.4 UL HARQ for two-hop transparent RS

When the RS receives the HARQ sub-burst correctly from MS, the RS forwards the sub-burst toward the MR-BS and saves it for any possible retransmission. When the RS does not successfully receive the HARQ sub-burst, the RS shall not forward the sub-burst.

It is also possible for MR-BS to receive the first transmission from MS directly. At the same time, MR-BS informs the RS about the transmissions it needs to monitor via Compact\_UL-MAP MONITOR IE. The RS, having the information on uplink resource allocations sent in UL-MAP for MS, monitors the HARQ sub-burst transmission sent by MS to MR-BS directly and attempts to decode it. When the RS receives the HARQ sub-burst correctly, the RS saves it for possible retransmission.

When RS receives the correct HARQ sub-burst from MS, RS informs MR-BS that RS can retransmit the HARQ sub-burst instead of MS by sending HARQ RS Report Extended subheader. When retransmission of the HARQ sub-burst is needed, MR-BS which receives this subheader, requests RS to retransmit the HARQ sub-burst and sends ACK on HARQ ACK Bitmap IE to MS directly. Otherwise MR-BS sends NAK to MS to retransmit the HARQ sub-burst.

Insert new sub-clause 6.3.17.5.5

#### 6.3.17.5.5 Resource Request for HARQ RS Report

The HARQ RS Report is sent by a RS using any available bandwidth grant from the <u>MR-BS</u> at the moment. It is possible that the RS may not have any bandwidth grant for sending the report. In this case, a CDMA ranging code method is used for requesting bandwidth grant from the <u>MR-BS</u>.

Deleted: MMR-BS

Deleted: MMR-BS

Deleted: MMR-BS

Deleted: MMR-BS

Deleted: MMR-BS

The MR-BS allocates a specific RS CDMA ranging code to a RS during initial ranging by sending RS\_CDMA\_Codes TLV in RNG-RSP. The code is allocated for requesting UL resource for sending HARQ RS Report Extended subheader. When RS needs to send HARQ RS Report, it sends the allocated CDMA ranging code toward the MR-BS. The MR-BS recognizes the RS with the help of the assigned RS code. It assigns uplink allocation for sending HARQ RS Report Extended subheader using CDMA Allocation IE for all the links up to the RS.

Modify Table 13c in sub-clause 6.3.2.2.7

ES type	Name	ES body size	Description
<u>5</u>	HARQ RS Report extended subheader	TBD (= size of RSID) Need to give size	See section 6.3.2.2.7.9
<del>5</del> 6-127	Reserved	-	=

Insert new sub-clause 6.3.2.2.7.9

# 6.3.2.2.7.9 UL HARQ RS Report extended subheader

Specify the last RS that has received the UL HARQ attempt successfully. The subheader is sent with a MAC header containing basic CID for the RS. The RS basic CID helps MR-BS in identifying the RS. The format of HARQ RS Report extended subheader is as described in table T1.

Deleted: MMR-BS

Table T1 - HARQ RS Report Extended Subheader

Name	Size	Description	
CID	16 bits	CID of the MS connection	
AI_SN	1 bit	HARQ ID Seq. No	
SPID/Reserved	2 bits	Subpacket ID when IR is defined by the FEC mode, otherwise reserved (encoded 0b00)	
ACID	4 bits	The ID of the HARQ channel that carries the UL HARQ attempt.	
Next Transmission Flag Included	1 bit	= 1, Next Transmission Flag is applicable	
		= 0, Next Transmission Flag is don't care	
Next Transmission Flag	1 bit	= 1, request to <u>MR-BS</u> for stopping next HARQ packet transmission	Deleted: MMR-BS
		= 0, request to MR-BS for resuming next HARQ packet transmission	Deleted: MMR-BS
			Deleted: UL/DL-HARQ

[Insert new subclause 6.3.2.3.43.6.11 and add table:]

Deleted: D

## 6.3.2.3.43.6.11 Compact\_UL-MAP MONITOR IE

<u>The Compact UL-MAP MONITOR IE provides the list of CIDs of the MS whose transmissions need to be monitored in the UL part of the current frame and relayed in the next frame to the MS.</u>

Syntax	Size	Notes
Compact UL-MAP IE() {		
<u>UL-MAP Type = 7</u>	3 bits	
UL-MAP subtype	<u>5 bits</u>	
Number of CIDs	4 bits	Number of CIDs in the IE
for(i=0; i <number cids;="" i++)<="" of="" td=""><td></td><td></td></number>		
CID(i)	<u>16 bits</u>	The CIDs of the connections that RS shall monitor in the current frame
_}		
1		

The following changes are on top of the changes proposed in [1].

Insert new subclause 11.19.1:

## 11.19 RS\_RNG-RSP management message encodings

Type

(1 byte)

The encodings described in this subclause are specific to the RS\_RNG-RSP message.

Length

Insert new subclause 11.19.1:

## 11.19.1 RS CDMA Codes TLV

Name

RS CDMA Code	-	3	The TLV carries I byte ranging code for indicating	4	Formatted: Bullets and Numbering
			HARQ Error Report,		Deleted: in the following order¶ HARQ Error Report
References					
[1] Resource Request for	Bandwid	th, C80216	j-07. 39.doc; Shashikant Maheshwari, Yousuf Saifullah,		Deleted: 6

[1] Resource Request for Bandwidth, C80216j-07, 39.doc; Shashikant Maheshwari, Yousuf Saifullah, Shashikant Maheshwari, Haihong Zheng, Masato Okuda, Kerstin Johnsson, Jerry Sydir, Wendy Wong, Hannah Lee; Nokia; Fujitsu; Intel

Value

Deleted: 18

Deleted: Yousuf Saifullah, Shashikant
Maheshwari, and Haihong Zheng

[2] DL HARQ with Relays, C80216j-07 002.doc, Junichi Suga, Michiharu Nakamura, Haihong Zheng, Yousuf Saifullah, Shashikant Maheshwari, Aik Chindapol, Jimmy Chui, Hui Zeng, Byung-Jae Kwak, Suchang Chae, Young-il Kim, Kyu Ha Lee; Fujitsu, Nokia, Siemens, ETRI, Samsung Thales,

Formatted: Font: (Default) Times

Formatted: Font: (Default) Times

**Deleted:** [2] DL HARQ method for user-transparent relaying, C80216j-06\_126r3.doc, Junichi Suga, Michiharu Nakamura, Aik Chindapol, Kyu Ha Lee, Young-il Kim; 2006-11-16

Page 6: [1] Deleted		Saifullah Yousuf		1/15/2007 1:55:00 PM		
	UL/DL-HARQ		1 bit		= 1, indicates the report is related to UL HARQ	
					= 0, indicates the report is related to DL HARQ	